


MONUMENT RECORD
Corner ID: Rich_K11
Section Corner
Section 16- T09N-R02W, 2nd P.M.
Richland Township, Monroe County, Indiana

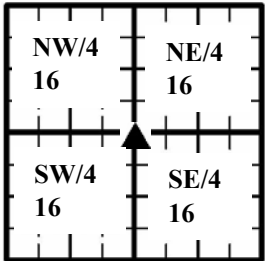

EXISTING SURVEY HISTORY

Include as much detail and history of the corner as known at the time of perpetuation.

SUBSEQUENT CORNER RESTORATION:

Date Surveyed: 8/16/1995 By: Michael W. Friley

Where filed or recorded: M.C.S.O. Files

Original monument: Brass Cap

Bearing Trees or Reference Monuments:

| I.D. | Dim. | Bearing | Distance |
|-----------------------|---------|------------|----------|
| PK in Post | 7"x7" | N 38°00' W | 29.76' |
| PK in Maple | 8" Dia. | N 56°30' E | 78.48' |
| "X" in Limestone Post | 20"x20" | S 35°00' W | 30.08' |

Notes:

SUBSEQUENT CORNER RESTORATION:

Date Surveyed: 2001-2004 By: Steven V. Farkas

Where filed or recorded: M.C.S.O. Files

Original monument: Brass Disk

Bearing Trees or Reference Monuments:

| I.D | Dim. | Bearing | Distance |
|--------------------|---------|---------|----------|
| NE Cor. Conc. Post | 18"x18" | S 40° W | 30.3' |
| Mag Nail | | N 90° W | 9.3' |
| PK in Post | | N 36° W | 29.9' |
| Top Bolt F.H. | | N 35° E | 57.1' |

Notes:

SURVEY EVIDENCE FOUND: Include evidence found and weighed, search area or areas, search procedure, etc.

Date of Search: 11/30/21 By: J.R. & K.H. Monument Found: Brass Disk in Concrete BTs or Reference Objects Found: Top Bolt of fire hydrant, "X" in limestone post, Mag nail in centerline of Ratliff Road Notes:

OTHER SURVEY HISTORY: Include details such as surveyor name, date, recording info, monument description, etc.

PERPETUATION RECORD

MONUMENT: Describe monument set or found (Include material type, scribing, distance above/below grade, dimensions.)

Brass Plate in concrete found 2 inches below grade near intersection of Louden Road and Ratliff Road

OTHER EVIDENCE: Describe corner location relative to nearby features and how to reach the corner location – note fences, roads, timber cutting lines, mow lines, clearings, plantings, streams, topo changes, etc.

Near the intersection of North-South running Louden Road and East-West running Ratliff Road

THEORY OF LOCATION: Describe the theory of location for acceptance of this monument with reference to the recording information for the survey upon which this record is derived. Said recorded survey shall be certified by the same professional surveyor who certifies this document, shall identify and accept this monument, and shall have been recorded within (3) years of Form submittal.

Ties prepared by Monroe County Surveyor Michael W. Friley show this monument was set on August 16th, 1995. Monroe County Surveyor Steven V. Farkas (2001-2004) later found this monument and new ties were created. It is noteworthy to mention that this brass plate did not create a sounding from a metal detector. This brass plate was found to be commonly accepted by surveys in the area and was accepted and held as said corner.

MONUMENT PRESERVATION: Describe work done to preserve existing monument. Stone mounds should be placed around monuments when stones are readily available. Paint corner stones but not the scribing. A Monroe County "PROTECT NEARBY SURVEY MARKER" sign shall be attached to a steel post when practicable. Note location and relation of corner to sign.

A Monroe County "PROTECT NEARBY SURVEY MARKER" sign was places on a steel post Northwest of the brass disk

GEODETIC COORDINATES: Northing: 1445638.5, Easting: 3078397.3

BASIS OF GEODETIC COORDINATES: Describe equipment, date, and personnel used to collect coordinates, datum, epoch, geoid and zone.

Coordinates shown hereon were obtained from GPS observations utilizing the Indiana Real-Time Network (INCORS). Indiana West Zone, NAD83(2011) Epoch 2010.0000, State Plane Grid Coordinates, US Survey Feet. Geoid model G2012BU7. Datum NAD83_NO_TRANS by Jackson Rogers and Kyle Hazelman on November 30th, 2021.


WITNESS MONUMENT TIES: Describe at least three new BT's and/or witness objects established or work done to preserve existing evidence. The following procedures are provided for guidance. Please utilize professional judgment when choosing witness ties.

All ties to BT's should be a magnetic nail and washer (state what kind) set in a hack mark at root crown (less than 12" above ground) perpendicular to center of tree unless otherwise noted. All monuments should be tied to at least three accessories with a minimum of 60° of separation. BTs should be healthy with a minimum DBH of 4". BT description should include tree species, diameter at 4.5' above ground, distance of nail above ground, and description of nail location (e.g., SE side of root). Note bearing from monument to the center of the BT, distance to the nail. Other survey monuments that were located in the vicinity and their relation to the monument may also be included.

| ID | Bearing | Distance | Description |
|----|---------|----------|---|
| B | S 42° W | 31.2' | "X" above grade in the Northeast side of Limestone Post |
| C | N 40° E | 57.1' | Top bolt of Fire Hydrant |
| D | N 30° W | 30.6' | T-Post with survey sign |

Notes:

MONUMENT RECORD
Corner ID: **Rich_K11**
Section Corner
Section 16- T09N-R02W, 2nd P.M.
Richland Township, Monroe County, Indiana

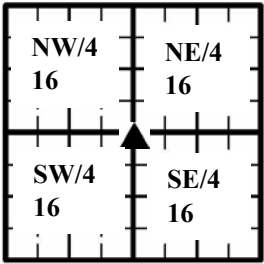

MONUMENT LOCATION SKETCH: Optional: Attach a sketch or aerial image. Monument sketch is not required for reimbursement.

PHOTO IDENTIFIED: Photograph close up photo of monument and a vicinity photo of the monument that includes the Monroe County “PROTECT NEARBY SURVEY MARKER” sign. Provide photo orientation and date. Additional photos may be included by clicking the “+” button at the end of the horizontal line.
Photo Date: *November 2021*



Photo Orientation & Description: *Looking down at K-11*



Photo Orientation & Description: *Looking North at K-11*

FIELD PERSONNEL:

Field Date: *11/30/21* By: *J.R. & K.H.* Project #: *21-157* Field Book: , page: Notes:

CERTIFICATION:

Professional Surveyor Name: *Eric L. Deckard*
Indiana Professional Surveyor No.: *29900012*
Firm Name: *Deckard Land Surveying*
Date: *12/03/21*


Signature:
Date:
Signature:





Seal:

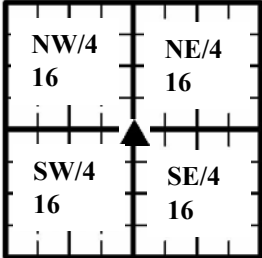

OFFICE USE ONLY

MONUMENT RECORD
Corner ID: Rich_K11
Section Corner
Section 16- T09N-R02W, 2nd P.M.
Richland Township, Monroe County, Indiana



| | | | |
|---|------------------------|--|------------------------------|
| NOTICE TO PROCEED AND MONUMENT RECORD FORM ISSUED TO: | | | |
| Offeror Name: Eric L. Deckard | | Firm Name: Deckard Land Surveying, LLC | |
| Phone: (812)961-0235 | | Email: Ericdeckard1@msn.com | |
| Corner Classification: Section Corner | | Corner Coordinate Status: Perpetuated | |
| Issue Date: 7/12/22 | Form Due Date: 7/21/22 | | Form Receipt Date: 7/21/2022 |

| | | |
|--|---------------|--|
| COUNTY SURVEYOR APPROVAL: | | Seal: |
| <input checked="" type="checkbox"/> Yes, Signature:  | Date: 7/19/22 |  |
| <input type="checkbox"/> No, reasons for denial | | |

| | | |
|--|---------------|---|
| SURVEYOR REVIEW BOARD APPROVAL: | | Seal: |
| <input checked="" type="checkbox"/> Yes, Signature:  | Date: 7/19/22 |  |
| <input type="checkbox"/> No, reasons for denial | | |